

COMMONWEALTH OF AUSTRALIA

DEPARTMENT OF TRANSPORT

AIRWORTHINESS DIRECTIVE GLIDERS

GFA AD/148 BRASOV 3

GLIDER TYPES AFFECTED: All IS 28B2 and all IS 29D and IS 29D2

SUBJECT: Swages to Cables

REQUIRED ACTION:

Before further flight all aluminium swaged sleeves are to be inspected for cracks using at least a 5X magnification aid.

The inspection is to determine whether there are longitudinal cracks in the aluminium alloy sleeves.

If cracks are found the cables are to be replaced or re-swaged using approved "TALURIT" or "NICROPRESS" swages using the appropriate tools.

The replacement is to be carried out by persons approved for Standard Repairs or C. of A. Inspections and the action entered up in the aircraft's log book.

COMPLIANCE:

This directive is issued pursuant to Air Navigation Regulations under the delegated authority of the Secretary, Department of Transport.

*Douglas Lyon.*

(Douglas Lyon)

CHIEF TECHNICAL OFFICER AIRWORTHINESS  
GLIDING FEDERATION OF AUSTRALIA

Date of issue: 4th June, 1979