

GLIDING FEDERATION OF AUSTRALIA.

AIRWORTHINESS DIRECTIVE GLIDERS:

GFA/AD 171 EIRIAVION OY/11

TYPES AFFECTED: PIK 20 E Serial Numbers 20215, 20221 to 20233
and 20235.

SUBJECT: The clip of the tow cable can touch the back side
of the fuel tank and possibly chafe the tank.

INSTRUCTIONS:

- (a) Remove the floor and the fuel tank.
- (b) Remove the cable clip and screw.
- (c) Attach the cable to the wheel house with a
good cloth tape.
- (d) Install the fuel tank and floor.
- (e) Check the controls carefully for free movement
in all positions.

COMPLIANCE: To be carried out at the next 25 hours maintenance
and entered in the log book.

This Directive is mandatory and is issued pursuant to
Air Navigation Regulations under the delegated
authority of the Secretary of the Department of
Transport.

Douglas Lyon

DOUGLAS LYON
CHIEF TECHNICAL OFFICER AIRWORTHINES:
GLIDING FEDERATION OF AUSTRALIA

Date of issue: 27th March, 1980.